

Revision Transmittal Sheet

This page transmits Revision 2 to Service Bulletin No. 75-57-01, "Wing Spar Inspection."

Rework:

No rework is required for aircraft which have complied with previous issues of this document.

Summary:

Updated Effectivity.

NOTE: Change bars are placed in the left margin of pages where significant changes are located. This revision incorporates the latest document format for Learjet service instructions. The general arrangement of this document may change from the previous issue.

Description of Changes

In the Planning Information section:

Changed the aircraft effectivity from 45-368, 45-446, and 45-456 thru 45-589 to 45-368, 45-446, and 45-456 thru 45-596.

Filing Instructions:

This is a COMPLETE revision. Remove and discard all pages of the prior issue and replace them with pages of Revision 2.

Record of Revisions:

ISSUE	DISTRIBUTION DATE
Basic	Feb 25/19
Revision 1	Oct 26/20
Revision 2	Apr 19/21

Service Bulletin

If the instructions in this publication cannot be completed because of an STC change to the aircraft, speak to the STC holder or the regional Federal Aviation Administration (FAA) office for information and disposition.

Contact Information	Distribution Date	Rev. No.
Business Aircraft Learjet Inc. MS 53 P.O. Box 7707 Wichita, Kansas 67277-7707 Customer Response Center (CRC) yul.parts@aero.bombardier.com 1-866-538-1247 (Toll Free) 1-514-855-2999 (Tel)	April 19, 2021	2

WINGS - WING SPAR INSPECTION

1. Planning Information

A. Effectivity

- (1) Learjet 45-368, 45-446, and 45-456 thru 45-596.

B. Reason

- (1) Corrosion has been observed on the lower wing splice plates that require a more frequent interval to detect and correct any protective coatings.

C. Description

- (1) This service bulletin provides instructions to perform an inspection of the center wing area from front spar to rear spar between wing stations 33.00L to 33.00R and all accompanying structure.

These commodities, technology or software were exported from the United States in accordance with the Export Administration Regulations. Diversion contrary to United States law is prohibited.

Refer to applicable government agency regulations and requirements and make sure that the work described in this publication is performed in compliance with manufacturer's recommendations and/or acceptable industry standards.

This document is proprietary to Bombardier Inc. and/or its affiliates and may not be reproduced or copied in any form or by any means without the prior written consent of Bombardier Inc. and/or its affiliates.

© 2019, Bombardier Inc. All rights reserved.
Challenger*, Global Express*, Learjet*, are Trademarks of Bombardier Inc.

LEARJET 75 Service Bulletin

D. Compliance

- (1) Recommended - The time compliance for this inspection is for aircraft that are eight years from Certificate of Airworthiness. Aircraft with greater than eight years from Certificate of Airworthiness have 12 months from February 25, 2019 to comply.

E. Approval

- (1) The Federal Aviation Administration (FAA) has approved the technical content in this publication that has an effect on the airplane type design.
- (2) The European Aviation Safety Agency (EASA) has accepted the technical content in this publication that has an effect on the airplane type design.
- (3) Transport Canada Civil Aviation (TCCA) has accepted the technical content in this publication that has an effect on the airplane type design.

F. Labor Hours - Estimated Accomplishment Time

LABOR HOURS	TASK
3.0	Labor hours to gain access.
1.0	Labor hours to do the aircraft modification.
3.4	Labor hours to return the aircraft to airworthy status.
7.4	Total Labor Hours

NOTE: The labor hours provided are estimates to assist scheduling and planning the tasks given in this bulletin. The estimates are for direct labor performed by an experienced crew and do not include the time for familiarization, planning, aircraft preparation in hangar, such as towing and positioning of scaffolds, removal of aircraft loose equipment, acquisition of tools and equipment, training, supervision and inspection.

If labor coverage is provided, only the hours above will be paid.

When planning to complete these instructions, please contact Bombardier Aerospace, Learjet Inc. Business Aircraft Customer Service, Parts Services for parts availability and shipping times as necessary. (Refer to the title page of this document for contact information.)

G. Expense Coverage

- (1) None.
- (2) Labor Coverage - None.
- (3) Material Coverage - None.
- (4) Smart Parts Plus Coverage
 - (a) None.

LEARJET 75 Service Bulletin

H. Material Required

- (1) There are no kits associated with these instructions.
- (2) Other materials/parts necessary to complete these instructions.

PART NUMBER	NOMENCLATURE	QTY	SUPPLIER
240 Grit (or finer) Aluminum Oxide	Abrasive Paper	As Required	Commercially Available
400 Grit Aluminum Oxide	Abrasive Paper	As Required	Commercially Available
Methyl Propyl Ketone (MPK)	Cleaning Solvent	As Required	Commercially Available

NOTE: You can use equivalent alternatives for these items.

For current prices, availability, ordering and shipping information, please call Bombardier Aerospace, Learjet Inc. Business Aircraft Customer Service, Parts Services. (Refer to the title page of this document for contact information.)

I. Tools, Equipment and Materials

- (1) Refer to [Part 4 of the Non-Destructive Inspection Manual](#), Ultrasonic Inspection - General Information.
- (2) Refer to [Part 6 of the Non-Destructive Inspection Manual](#), General Procedure for Inspection of Surface Cracks on Aluminum Alloy Parts.

J. Weight and Balance

- (1) Negligible.

K. References

NOTE: If applicable, referenced third party documentation can be accessed from the Customer Portal under this service bulletin number.

- (1) Service Bulletin Compliance Response Form.
- (2) Service Bulletin Evaluation Sheet.
- (3) Learjet Maintenance Manual, Chapters 6 and 24.
- (4) Learjet Structural Repair Manual, Chapter 51.
- (5) Learjet Non-Destructive Inspection Manual, Part 4 and 6.

2. Material Information

A. Parts Required

- (1) There are no kits associated with these instructions. Refer to Paragraph 1.H. for more materials/parts necessary to complete these instructions.

LEARJET 75 Service Bulletin

3. Accomplishment Instructions

A. Gain Access

- (1) Set the battery switches to OFF. If necessary, disconnect external electrical power and the main and emergency batteries from the aircraft. (Refer to [Chapter 24 of the Maintenance Manual](#).)
- (2) Remove panels 510AC, 510BC, 510BL, and 610BR. (Refer to [Chapter 6 of the Maintenance Manual](#).)
- (3) Lower panels 510AL, 610AR, 720BL, and 730BR. (Refer to [Chapter 6 of the Maintenance Manual](#).)

B. Modification of Aircraft

- (1) Perform a visual inspection for corrosion or deterioration (cracked, chipped, peeling, or thinning) of protective treatments of the center wing area from front spar to rear spar between wing stations 33.00L to 33.00R. (See [Figure 1](#).)
 - (a) Do an inspection of the forward and aft sides of the front, mid, and rear center wing spars.
 - (b) Do an inspection of the left and right hand ribs at WS 5.8, WS 16.5, and WS 33.0.
 - (c) Do an inspection of the front, mid, and rear spar splice plates.
 - (d) Carefully examine the accompanying fasteners.
- (2) Deleted.
- (3) If no corrosion is found and the protective treatments are not deteriorated, go to step 3.B.(9).
- (4) If no corrosion is found but the protective treatments are deteriorated:
 - (a) As necessary treat the deteriorated areas in accordance with [Chapter 51 of the Structural Repair Manual](#), Revision 22 or later approved revision.
 - (b) After the protective treatments have been applied go to step 3.B.(9).
- (5) If corrosion is found:

CAUTION: DO NOT REMOVE MORE THAN 50% OF THE FASTENERS AT ONE TIME WITHOUT SHORING THE WING.

- (a) As necessary, remove fasteners to get access to the corrosion.
 - 1) Do not remove more than 50% of the fasteners at one time without shoring the wing. Contact the Learjet Customer Response Center for shoring procedures.
- (b) Blend the corroded area as follows:
 - 1) Blend the corrosion area with a minimum 10:1 blend ratio. (See [Figure 2](#).)

CAUTION: DO NOT USE STEEL WOOL, STEEL WIRE BRUSHES OR SEVERE ABRASIVES WHEN YOU REWORK THE STRUCTURE FOR CORROSION. USE 240 GRIT OR FINER ALUMINUM OXIDE ABRASIVE PAPER. FINISH WITH 400 GRIT PAPER.

- 2) Get the necessary tools and equipment.
- 3) Clean the corroded area so that all loose corrosion and debris is removed from the rework areas.
- 4) Use 240 grit and then progressively finer grit aluminum oxide abrasive paper to sand and blend the corroded areas to get the specified surface finish. (See [Figure 2](#).)

LEARJET 75 Service Bulletin

WARNING: SPECIAL PRECAUTIONS MUST BE OBSERVED DURING CLEANING. CLEANING SOLVENTS ARE TOXIC AND FLAMMABLE. YOU MUST WEAR PROTECTIVE MASK AND SUPPLY SUFFICIENT VENTILATION WHEN YOU USE THE CLEANING SOLVENTS.

YOU MUST FOLLOW THE MANUFACTURER'S PUBLISHED INSTRUCTIONS WHEN YOU USE CLEANING SOLVENTS.

- 5) With a clean cloth soaked with cleaning solvent (MPK), clean the sanded surface.
 - a) Immediately wipe the area dry with a clean, dry cloth.
 - b) Do not let the cleaning solvent be "wicked" under the adjacent structure.
- 6) Make sure to keep a RMS 63 finish or better.
- (c) Do an eddy current inspection of the blended areas as follows:

NOTE: This inspection is to make sure the corrosion is removed.

- 1) Complete the eddy current inspections in accordance with Learjet NDI-104 manual, Part 6, Eddy Current Inspection (General) and Part 6, 51-00-01, General Procedure for Inspection of Surface Cracks on Aluminum Alloy Parts, Revision 23 or later approved revision.
- 2) All NDI analysis must be done by an NAS 410 or ANST equivalent minimum level II inspector qualified to the specific methodology.
- (d) If corrosion is found during the eddy current inspection:
 - 1) Do the blending procedures again in accordance with step (b) above.
 - 2) Do the eddy current inspection again on the new blended areas in accordance with step (c) above.
- (6) Do the ultrasonic thickness measurements as follows:
 - (a) Lay out the 0.5 by 0.5 inch grids for the ultrasonic thickness measurements over the blended areas that extend to undamaged material. (See [Figure 1](#), Details B, C, D and associated views for typical examples.)

NOTE: The spar flange tapers in both the inboard/outboard and forward/aft directions. Document the position of the grid for the ultrasonic thickness measurements with two dimensions to key spar features. Complete the ultrasonic measurements square to the X axis. [The X axis is the monument lines (webs, corners, etc.) that are parallel to the aircraft centerline.]

- (b) Do the ultrasonic thickness measurements within each grid area in accordance with Learjet NDI-104 manual, Part 4, Ultrasonic Inspection, and ASTM standards, ASTM E797/E797M Standard Practice for Measuring Thickness by Manual Ultrasonic Pulse-Echo Contact Method, as follows:
 - 1) All NDI analysis must be done by an NAS 410 or ANST equivalent minimum level II inspector qualified to the specific methodology.
 - 2) To capture the taper thickness, make sure to measure at least two locations within the blended area.
 - 3) Make sure the measurements are taken where the most material was removed.
 - 4) Extend the ultrasonic measurements two grid points past the blended area minimum.
- (c) Give the results of the ultrasonic measurements, with digital photos of all blended areas, to the Learjet Customer Response Center for analysis by Customer Support Engineering of the blended area remaining material thickness.
- (d) Do not proceed until approval has been received from Learjet Customer Support Engineering for all corrosion repairs.


LEARJET 75 Service Bulletin

- (7) After engineering approval of the corrosion repair, apply the protective treatment to all repaired and deteriorated areas in accordance with [Chapter 51 of the Structural Repair Manual](#), Revision 22 or later approved revision.
- (8) Replace all removed hardware with new hardware in accordance with [Chapter 51 of the Structural Repair Manual](#), Revision 22 or later approved revision.

NOTE: You can procure all new hardware locally or contact Learjet Spare Parts Sales.

- (a) If necessary, remove the wing shoring.
 - (9) Install equipment removed for inspection or repair.
 - (10) Install panels 510AC, 510BC, 510BL, and 610BR. (Refer to [Chapter 6 of the Maintenance Manual](#).)
 - (11) Close panels 510AL, 610AR, 720BL, and 730BR. (Refer to [Chapter 6 of the Maintenance Manual](#).)
- C. Return Aircraft to Airworthy Status
- (1) Connect the main and emergency batteries to the aircraft. (Refer to [Chapter 24 of the Maintenance Manual](#).)
 - (2) Install any additional items removed for access.
- D. Compliance Response Form
- (1) Complete the compliance response form.
 - (2) Send the compliance response form to Learjet Inc. as soon as possible.
- E. Aircraft Maintenance Records
- (1) Complete the Aircraft Maintenance Records in accordance with the regulatory requirements of the appropriate aircraft certification authority.

**LEARJET 75
Service Bulletin**

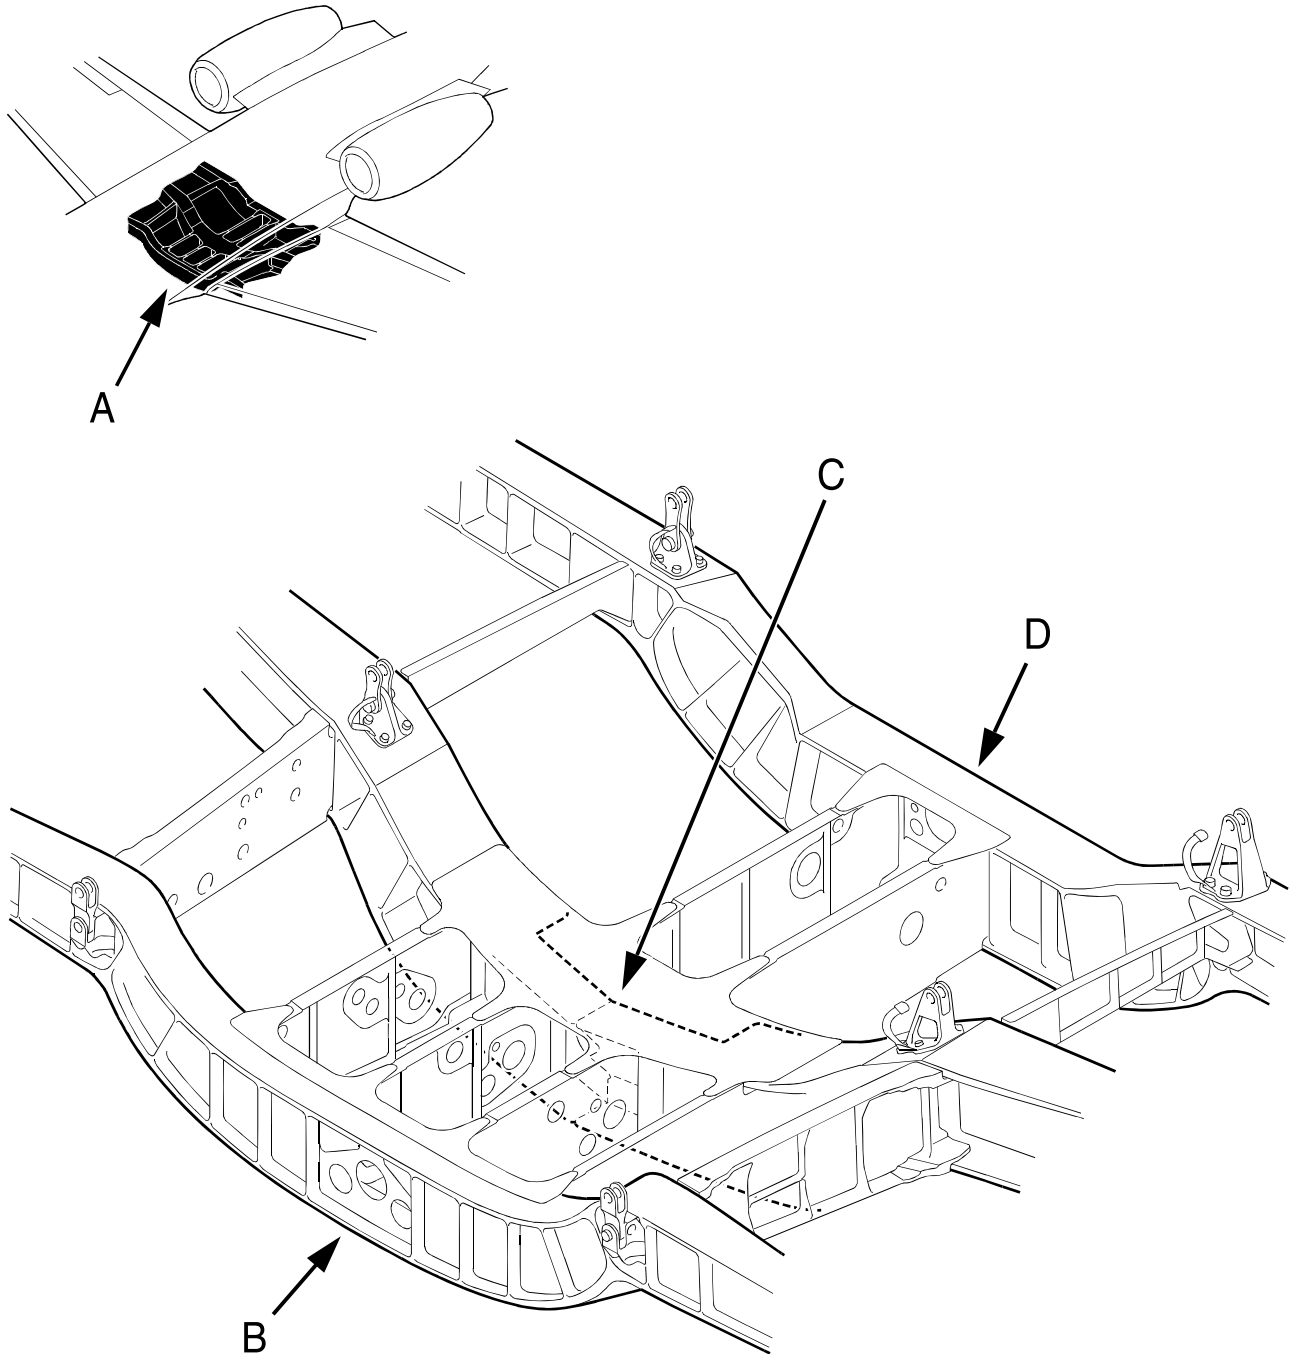

**CENTER WING STRUCTURE
SKIN AND ASSOCIATED EQUIPMENT NOT SHOWN FOR CLARITY**

Detail A

K75-755701-001-01


Wing Spar Inspection
Figure 1 (Sheet 1 of 4)

Basic Issue: Feb 25/2019
Revision 2: Apr 19/21

THIS PUBLICATION IS AVAILABLE AT:
<https://my.businessaircraft.bombardier.com>

SB 75-57-01
Recommended
Page 7 of 11


LEARJET 75
Service Bulletin

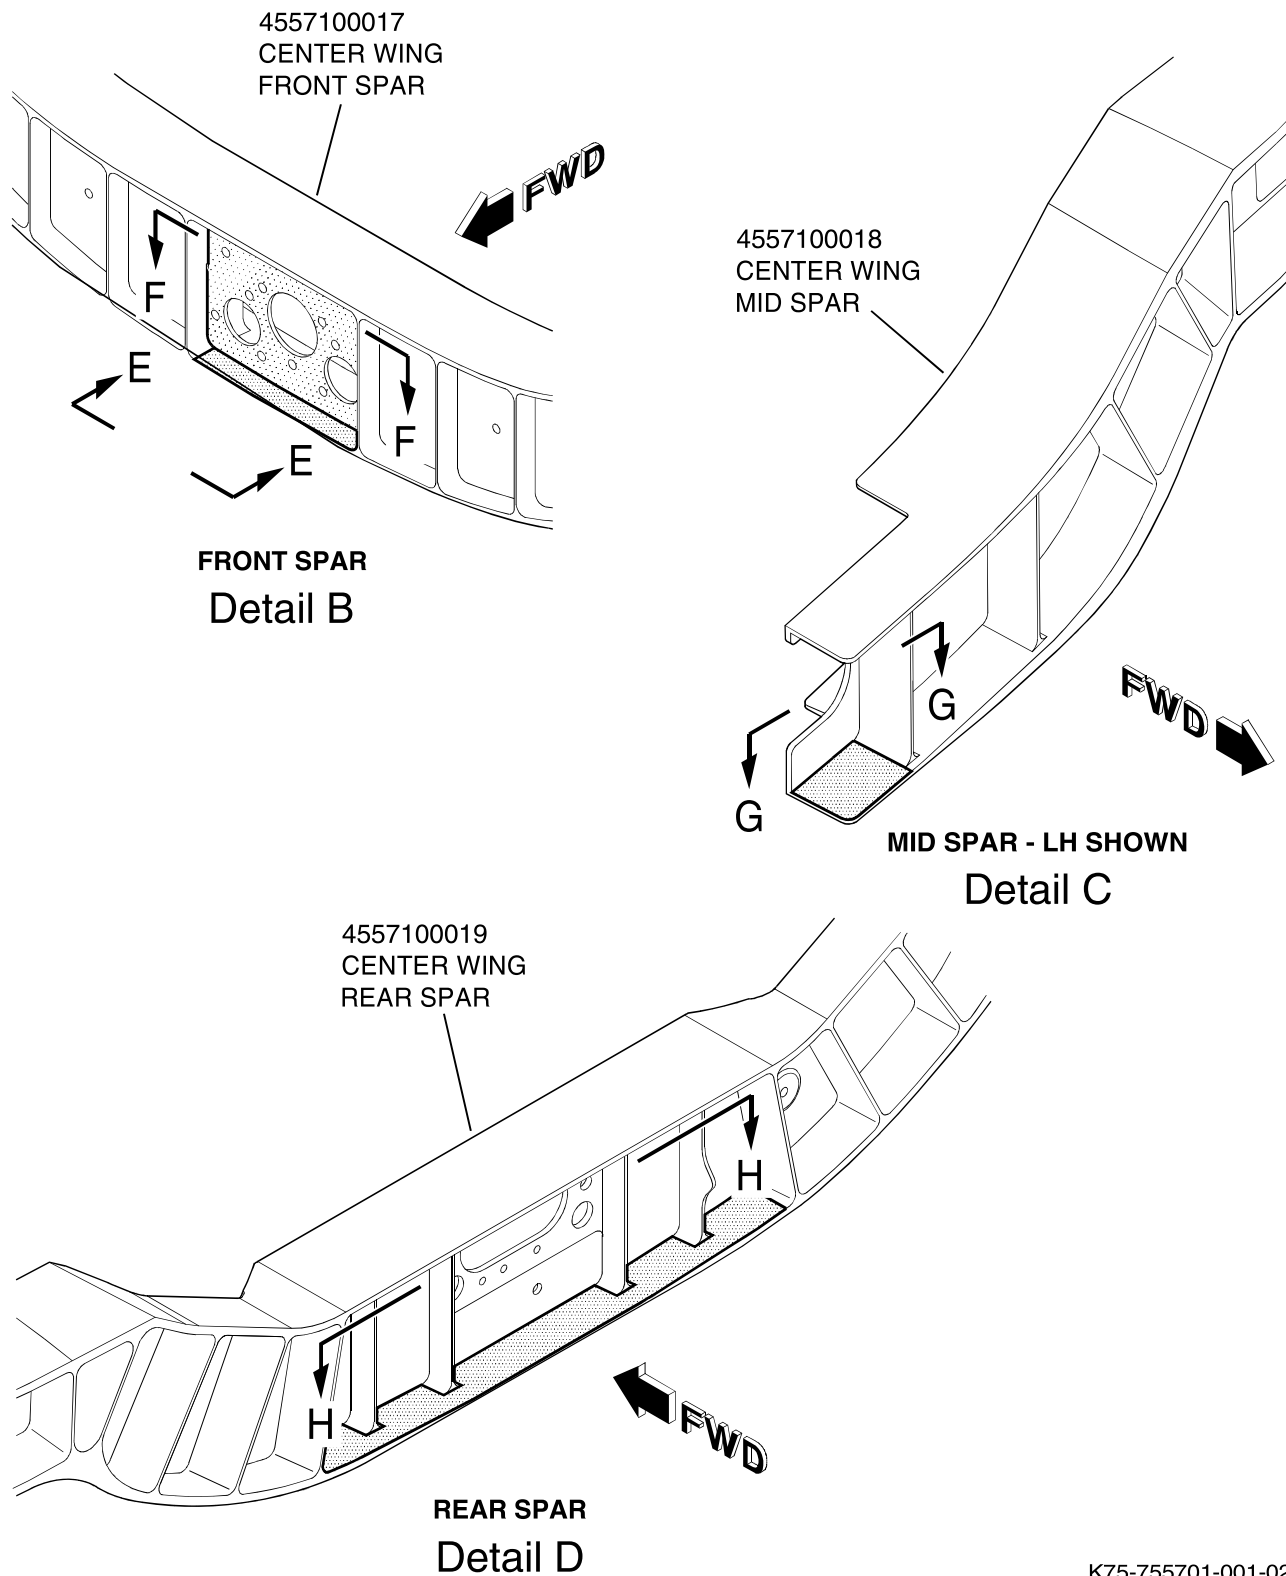

K75-755701-001-02


Wing Spar Inspection
Figure 1 (Sheet 2 of 4)

LEARJET 75 Service Bulletin

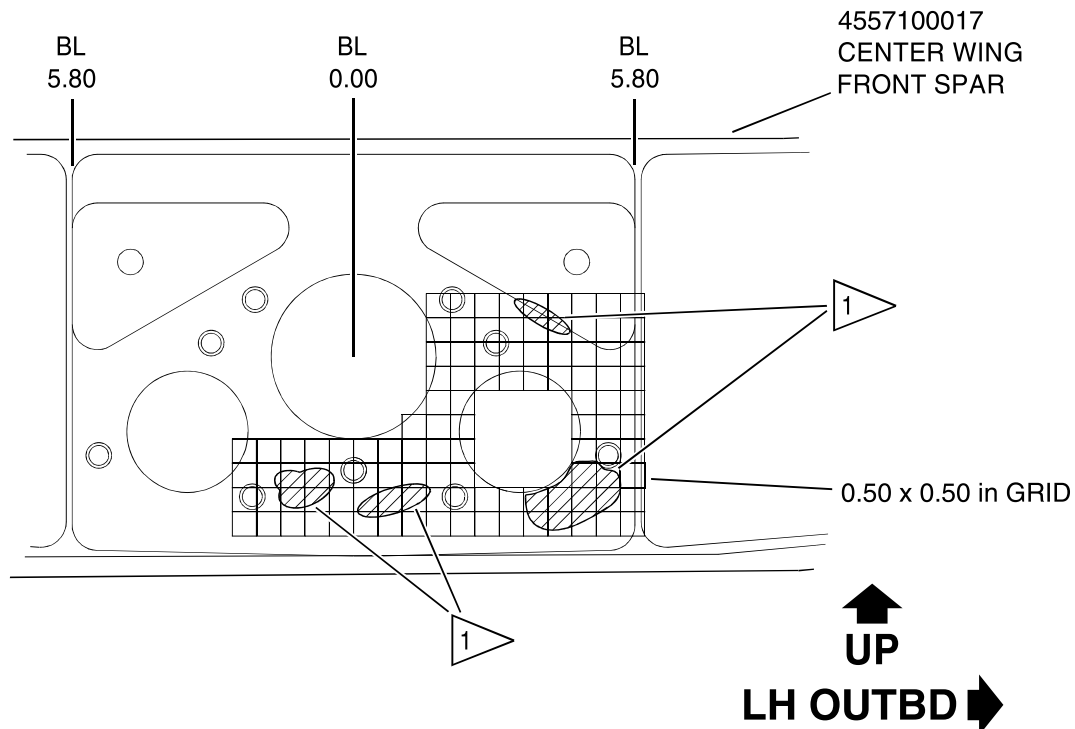

**FRONT SPAR GRID
VIEW LOOKING AFT**

View E-E

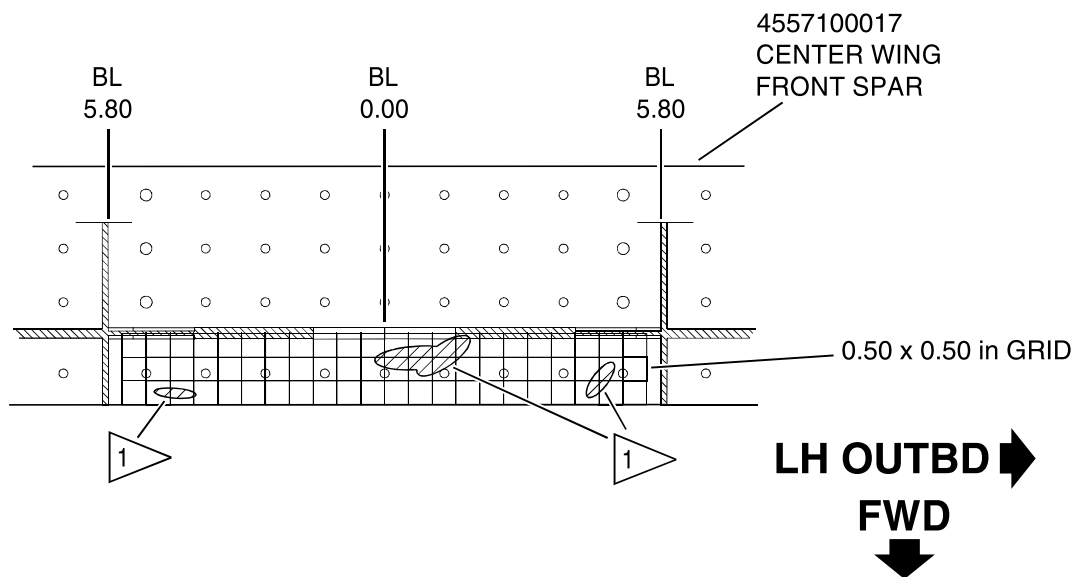

**FRONT SPAR GRID
VIEW LOOKING DOWN ON LOWER FLANGE**


View F-F

NOTE
1 Typical blended areas.


K75-755701-001-03

Wing Spar Inspection
Figure 1 (Sheet 3 of 4)

LEARJET 75 Service Bulletin

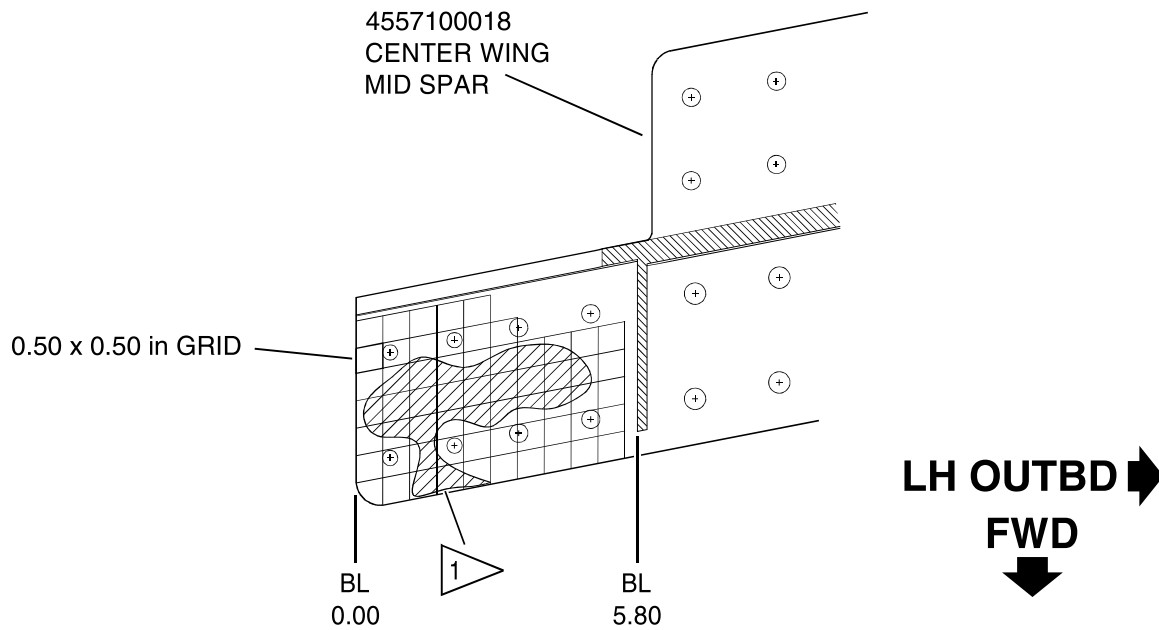

**MID SPAR GRID - LH SHOWN
VIEW LOOKING DOWN ON LOWER FLANGE**
View G-G

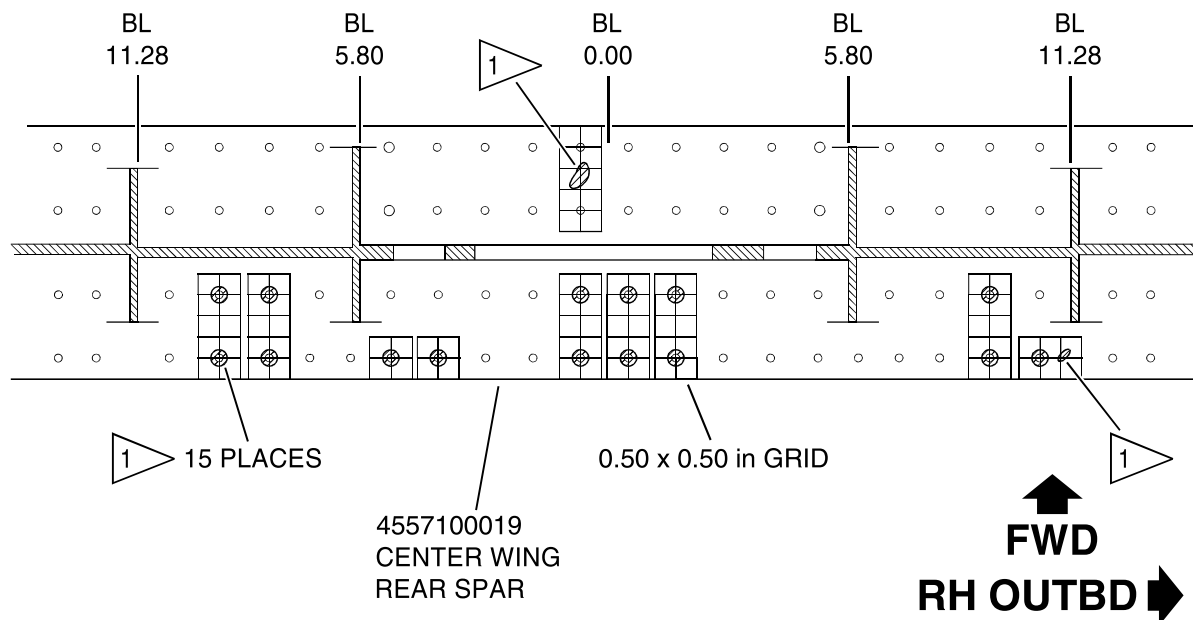

**REAR SPAR GRID
VIEW LOOKING DOWN ON LOWER FLANGE**
View H-H

NOTE
1 Typical blended areas.

K75-755701-001-04


Wing Spar Inspection
Figure 1 (Sheet 4 of 4)

Basic Issue: Feb 25/2019
Revision 2: Apr 19/21


THIS PUBLICATION IS AVAILABLE AT:
<https://my.businessaircraft.bombardier.com>

SB 75-57-01
Recommended
Page 10 of 11


**LEARJET 75
Service Bulletin**

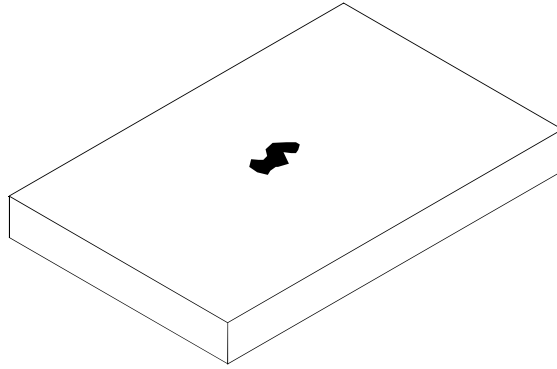

CORROSION DAMAGE BEFORE REWORK

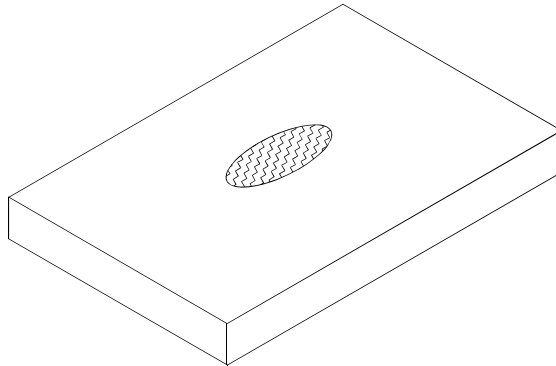

**DEPRESSION AFTER CORROSION REMOVAL
(ROUGH EDGES HAVE BEEN SMOOTHED AND
ALL CORROSION HAS BEEN REMOVED)**

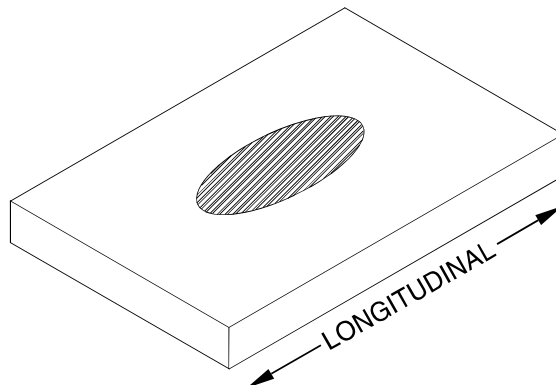

**DISH-OUT AFTER BLENDING
(BLENDING HAS BEEN ACCOMPLISHED IN THE
RATIO SPECIFIED AND DIRECTION SHOWN)**

K75-755701-002-01

Corrosion Blending
Figure 2 (Sheet 1 of 1)

Basic Issue: Feb 25/2019
Revision 2: Apr 19/21

THIS PUBLICATION IS AVAILABLE AT:
<https://my.businessaircraft.bombardier.com>

SB 75-57-01
Recommended
Page 11 of 11


BOMBARDIER

CLICK HERE TO EMAIL


Comments

▼ FOLD HERE FIRST ▼

BOMBARDIER

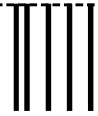

 NO POSTAGE
NECESSARY
IF MAILED
IN THE
UNITED STATES



BUSINESS REPLY MAIL

FIRST-CLASS MAIL PERMIT NO. 2928 WICHITA, KS

POSTAGE WILL BE PAID BY ADDRESSEE

ATTN: MAINTENANCE ENGINEERING (MS NO. 78)
LEARJET INC
PO BOX 7707
WICHITA, KS 67277-9801



▲ FOLD HERE LAST. SEAL WITH TAPE. DO NOT STAPLE. ▲

SERVICE BULLETIN EVALUATION SHEET

BOMBARDIER

[CLICK HERE TO EMAIL](#)

YOUR COMMENTS WILL HELP US IMPROVE OUR SERVICE BULLETINS

*An email will be opened addressed to the SB Group and this form will be attached.

SERVICE BULLETIN: 75-57-01 REVISION: 2 DATED: April 19, 2021

TITLE: Wing Spar Inspection

	POOR	FAIR	GOOD	VERY GOOD	EXCELLENT
HOW EASY IS THE BULLETIN TO UNDERSTAND? COMMENTS	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
DOES THE BULLETIN TELL YOU ALL YOU NEED TO KNOW ABOUT THE JOB? COMMENTS	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
DO YOU THINK THE BULLETIN CONVEYS THE BEST WAY TO DO THE JOB? COMMENTS	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
HOW REALISTIC ARE THE LABOR-HOUR ESTIMATES? COMMENTS	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
WHAT IS YOUR APPRECIATION OF THE ILLUSTRATION(S)? COMMENTS	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

Actual hours to accomplish Service Bulletin: Access: _____ Modify: _____ Test(s): _____ Restore: _____

PLEASE SUPPLY THE FOLLOWING: NAME: _____


OPERATOR: _____ EMAIL: _____

AIRCRAFT: _____ TELEPHONE: _____


UPON COMPLETION OF THE EVALUATION FORM, YOU MAY FOLD AND RETURN TO ADDRESS ON THE REVERSE SIDE OR USE THE SUBMIT BUTTON AT THE TOP TO EMAIL IT.

BOMBARDIER

▼ FOLD HERE FIRST ▼

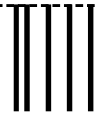

 NO POSTAGE
NECESSARY
IF MAILED
IN THE
UNITED STATES



BUSINESS REPLY MAIL

FIRST-CLASS MAIL PERMIT NO. 2928 WICHITA, KS

POSTAGE WILL BE PAID BY ADDRESSEE

ATTN: TECHNICAL PUBLICATIONS (MS NO. 53)
LEARJET INC
PO BOX 7707
WICHITA, KS 67277-9801



▲ FOLD HERE LAST. SEAL WITH TAPE. DO NOT STAPLE. ▲